


GROUP F

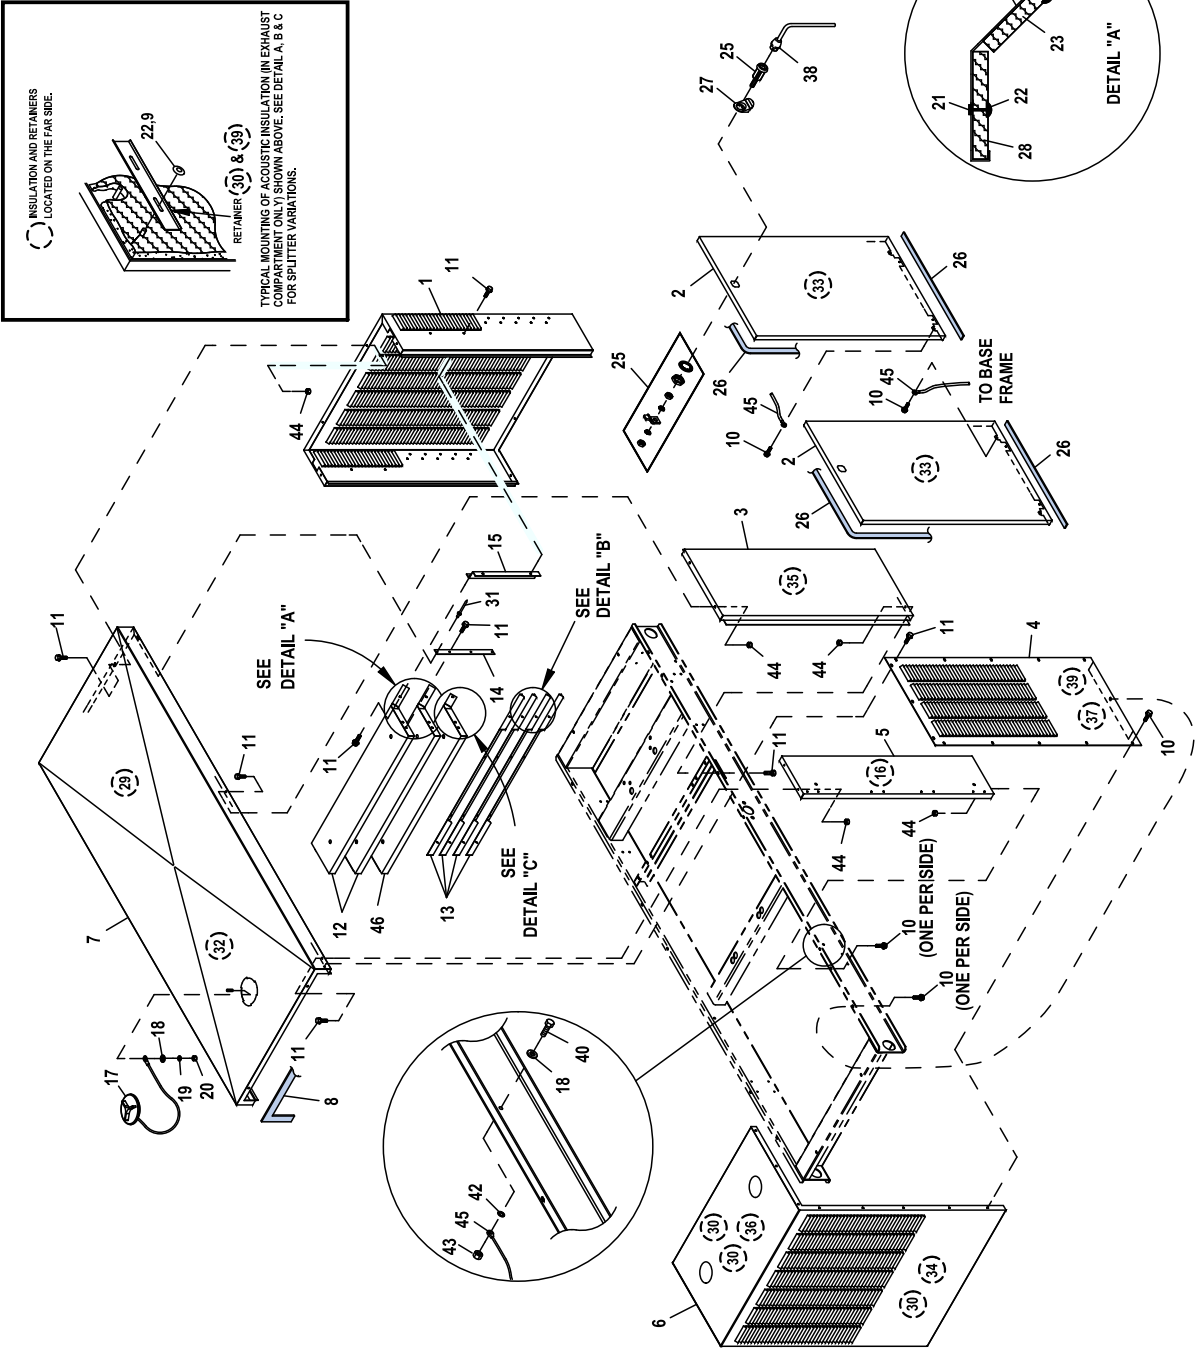

EXPLODED VIEW: EV ENCLOSURE C5 EMISSION**DRAWING #: 0J0204****GROUP F****APPLICABLE TO:**

ITEM	PART#	QTY.	DESCRIPTION
(2) 1	0F58730AL0R	1	REAR WRAP C5
(2) 2	0F5868AAL0R	4	DOOR C5
(2) 3	0F5872AAL0R	2	CENTER SUPPORT C5
(2) 4	0F58710AL0R	2	DISCHARGE DUCT LH & RH SIDE C5
(2) 5	0F5869AAL0R	2	FRONT CORNERS C5
(2) 6	0K88730AL0R	1	DUCT CENTER DISCHARGE RAW
(2) 7	0F58670AL0R	1	ROOF C5 ALUM
8	G066760	1	STRIP SEALANT 1/8 X 1 (44.5"LG)
9	078115A	12	WASHER SELF LOCKING DOME #8-32
(1)10	0E3257	16	SCREW TH-FRM M6 W/CAP SHKPRF W
(1)11	0C2454	80	SCREW THF M6-1 X 16 N WA Z/JS
12	0F2766	2	SPLITTER
13	0F3181	4	SPLITTER SHORT
14	0F3185	2	STRINGER SPLITTER C3
15	0F3416	2	SUPPORT SPLITTER C5 130KW
16	0J0336	2	INSUL CORNER POST
17	0C2634A	1	ASSY ACCESS COVER
18	G022473	5	WASHER FLAT 1/4-M6 ZINC
19	G022097	1	WASHER LOCK M6-1/4
20	G022127	1	NUT HEX 1/4-20 STEEL
21	0F3072	20	INSULATION RETAINMENT HANGER
22	G078115	30	WASHER SELF LOCKING DOME #4-40
23	0J0336B	3	INSUL SPLITTER
24	0J0336A	4	INSUL SHORT LOUVER
25	0F5048D	4	WISE-ACTION LATCH SLOTTED CIR
26	0E5968	1	GASKET EXTRUDED TRIM (566" LG)
27	0F5049B	4	PULL TAB DOOR LOCK SS
28	0J0336G	2	INSUL SPLITTER SML
29	0J2624B	1	INSUL ROOF TOP REAR
30	0F3890A	3	RETAINER INSULATION (740)
31	G087233	2	RIVET POP .1875 X .450 SS
32	0J0336C	1	INSUL ROOF TOP FRT
33	0J0336D	4	INSUL DOOR
34	0F3949G	1	INSUL DISCHARGE DUCT
35	0J0336F	2	INSUL CENTER SUPPORT
36	0F3949K	1	INSUL DISCHARGE DUCT TOP
37	0F3949F	2	INSUL INNER DUCT SIDE
38	0F8869D	1	KEY VISE-ACTION LATCH SLOT CIR
39	0F3890	2	RETAINER INSULATION (450)
40	G042568	4	SCREW HHC M6-1.0 X 20 G8.8
42	G022447	4	WASHER SHAKEPROOF INT 1/4
43	G049813	4	NUT HEX M6 X 1.0 G8 YEL CHR
(1) 44	G077992	28	NUT HEX LOCK M6-1.0 SS NY INS
45	0912970090	4	ASSY WIRE 14AWG GRN/YEL
46	0F2766A	1	SPLITTER C5
47	0J0336H	1	INSUL SPLITTER SHRT MPS

NOTES (UNLESS OTHERWISE SPECIFIED):

(1) ENCLOSURE NOTE: ALL PANELS THAT FASTEN TO THE BASEFRAME MUST BE SECURED USING I/N 10 & 11 (THREAD FORMING FASTENERS) AND I/N 44 (LOCK NUT). LOCK NUT IS TO BE INSTALLED AFTER THREAD FORMING FASTENER HAS PENETRATED THROUGH EXTRUSIONS IN ENCLOSURE PANELS. ALL PANEL TO PANEL CONNECTIONS TO INCLUDE AT LEAST ONE CONNECTION POINT USING I/N 10 (THREAD FORMING FASTENER).NOTES

(2) SHEET METAL PARTS LISTED IN THE BOM TABLE, PRIOR TO 1/1/16, ARE REPRESENTING GENERIC PARTS (NO COLOR)

- MANUFACTURING: FOR CORRECT MATERIAL AND COLOR REFER TO SAP BOM.
- CUSTOMER: WHEN ORDERING REPLACEMENT PARTS ENTER BASE NUMBER (FIRST 6 DIGITS ONLY) IN THE SYSTEM FOR CORRECT MATERIAL AND COLOR (FOR REFERENCE SEE GUIDELINE 0H7169).